

NORTON MUNI (NRN)(KNRN) 1 N UTC-6(-5DT) N39°51.03' W99°53.68'

WICHITA
L-10H
IAP

2384 B NOTAM FILE ICT

RWY 16-34: H4701X60 (CONC) HIRL 0.5% up NW

RWY 16: REIL. PAPI(P2L)—GA 3.0° TCH 44'.

RWY 34: REIL. PAPI(P2L)—GA 3.0° TCH 43'.

RWY 08-26: 2117X125 (TURF)

RWY 08: Trees.

SERVICE: FUEL 100LL, JET A, A1+ LGT HIRL Rwy 16-34 opr consly.

ACTVT PAPI Rwy 16 and 34—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z†. Fuel 24 hr self-serve. No line of sight between rwy ends. Rwy 08-26 sfc rough.

Rwy 16-34 rwy sfc rough due to uneven paving joints every 10 ft.

AIRPORT MANAGER: 785-877-2201

WEATHER DATA SOURCES: AWOS-3PT 118.275 (785) 871-4009.

COMMUNICATIONS: CTAF 122.9

® DENVER CENTER APP/DEP CON 132.7

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE HLC.

HILL CITY (VH) (H) VORTACW 113.7 HLC Chan 84 N39°15.52'


W100°13.55' O15° 38.7 NM to fld. 2690/8E.

VOR unusable:

271°-274° byd 40 NM

279°-289° byd 40 NM blo 4,800'

279°-289° byd 47 NM

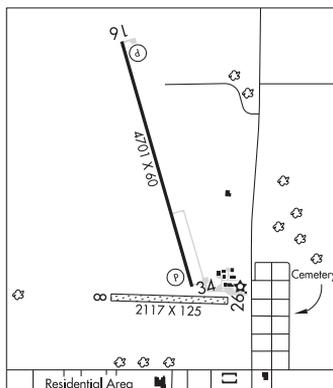

NORWICH (49K) 1 E UTC-6(-5DT) N37°27.33' W97°50.02'

WICHITA

1494 NOTAM FILE ICT

RWY 17-35: 3230X80 (TURF) LIRL(NSTD)

RWY 17: P-line.

RWY 35: Thld dsplcd 180'. Railroad.

SERVICE: LGT NSTD LIRL Rwy 17-35, incorrect spacing.

AIRPORT REMARKS: Unattended. Rwy 35 dsplcd thld marked with 2 lgts either side with painted tires. Irrigation pump and fuel tank 75' left of centerline Rwy 17 150' S of thld.

AIRPORT MANAGER: 620-704-3339

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Wichita Apch at 316-350-1520.

OKLEY MUNI (OEL)(KOEL) 2 SE UTC-6(-5DT) N39°06.71' W100°49.01'

WICHITA
H-5B, L-10G
IAP

3045 B NOTAM FILE ICT

RWY 16-34: H5000X75 (CONC) S-30 MIRL 0.5% up NW

RWY 16: REIL. PAPI(P2L)—GA 3.0° TCH 44'. Bldg.

RWY 34: REIL. PAPI(P2L)—GA 3.0° TCH 44'.

RWY 08-26: 2153X110 (TURF)

RWY 26: Road.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 16: TORA-5000 TODA-5000 ASDA-5000 LDA-5000

RWY 34: TORA-5000 TODA-5000 ASDA-5000 LDA-5000

SERVICE: S4 FUEL 100LL, JET A, A1+ LGT ACTVT REIL Rwy 16 and

Rwy 34; PAPI Rwy 16 and Rwy 34; MIRL Rwy 16-34—CTAF. Rwy

16 PAPI unusable byd 8° right and 6° left of centerline. Rwy 34 PAPI

unusable beyond 8° left of centerline.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z†. For svc after hrs call 785-672-0147. Fuel 24 hrs self-serve.

AIRPORT MANAGER: 785-672-0147

WEATHER DATA SOURCES: AWOS-3 118.325 (785) 671-4194.

COMMUNICATIONS: CTAF/UNICOM 122.8

® DENVER CENTER APP/DEP CON 132.7

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE HLC.

HILL CITY (VH) (H) VORTACW 113.7 HLC Chan 84 N39°15.52' W100°13.55' 244° 28.9 NM to fld. 2690/8E.

VOR unusable:

271°-274° byd 40 NM

279°-289° byd 40 NM blo 4,800'

279°-289° byd 47 NM

