

MOLOKAI

KALAUPAPA (LUP)(PHLU) 2 N UTC-10 N21°12.66' W156°58.42'

HAWAIIAN ISLANDS

24 B TPA—800(776) NOTAM FILE MKK

P-2G

RWY 05-23: H2700X75 (ASPH) S-17 MIRL

IAP

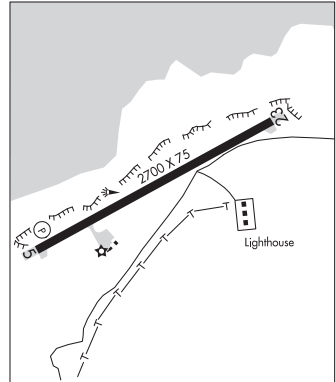
RWY 05: PAPI(P2L)—GA 3.0° TCH 19'.**RWY 23:** Rgt tfc.**SERVICE:** LGT ACTVT MIRL Rwy 05-23 med instst only—CTAF. PAPI Rwy 05 daytime VFR use only. Rwy 05 PAPI unusbl byd 2.2 NM.

Terrain penetrates PAPI safety slope at 2.7 NM. PAPI OTS indefly.

AIRPORT REMARKS: Attended Mon-Fri 1700-0130Z. PPR from State Department of Health, Communicable Disease Division to enter settlement area phone Honolulu (808) 586-4580. 24 hrs PPR for Division 1.1, 1.2, 1.3 explosives and 4 hrs PPR for other hazardous material in/out of arpt ctc (808) 567-9660/9663. Deer and wild animals on and invof arpt at night. Oct-May large waves impacting shoreline resulting in salt water sprays 40' high. NOTE: See Area Notices—TRAFFIC ADVISORIES AT NON-TOWER ARPTS.**AIRPORT MANAGER:** 808-872-3830**COMMUNICATIONS:** CTAF 122.9**MOLOKAI RCO** 122.1R 116.1T (HONOLULU RADIO)® **HCF CENTER APP/DEP CON** 124.1**CLEARANCE DELIVERY PHONE:** For CD ctc Honolulu Control Facility at 808-840-6262.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MKK.**MOLOKAI (H) (H) VORTAC** 116.1 MKK Chan 108 N21°08.29' W157°10.05' 057° 11.7 NM to fld. 1421/11E.

VORTAC unusable:

275°-285° byd 25 NM blo 3,500'

**MOLOKAI** (MKK)(PHMK) 6 NW UTC-10 N21°09.17' W157°05.78'

HAWAIIAN ISLANDS

454 B TPA—See Remarks Class I, ARFF Index A NOTAM FILE MKK

P-2G

RWY 05-23: H4494X100 (ASPH-GRVD) S-30, D-60 PCR 104 F/A/X/T

IAP, AD

MIRL 0.4% up NE

RWY 05: REIL. PAPI(P4L)—GA 4.0° TCH 49'.**RWY 23:** Thld dsplcd 593'. Brush.**RWY 17-35:** H3118X100 (ASPH) S-13 PCR 124 F/B/X/T MIRL

0.6% up N

RWY 17: Thld dsplcd 426'. Fence.**RWY 35:** Fence.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 05:** TORA-4494 TODA-4494 ASDA-4494 LDA-4494**RWY 17:** TORA-3118 TODA-3118 ASDA-3118 LDA-2692**RWY 23:** TORA-4494 TODA-4494 ASDA-4494 LDA-3901**RWY 35:** TORA-3118 TODA-3118 ASDA-3118 LDA-3118**SERVICE:** LGT When twr closed ACTIVATE MIRL Rwy 05-23 and Rwy 17-35, REIL Rwy 05—CTAF. Rwy 05 PAPI not authorized 1.8 NM byd landing thld due to rapidly rising terrain.**AIRPORT REMARKS:** Attended 1500-0615Z. Be alert to egrets and pigeons on and in vicinity of arpt. TPA—small acft 1250(796) large acft 1950(1496). Arpt CLOSED to air carrier operations with more than 10 passenger seats 0530-1600Z except PPR call (808) 567-9660/9663.

24 hrs PPR for Division 1.1, 1.2, 1.3 explosives and 4 hrs PPR for other hazardous material in/out of arpt ctc (808) 567-6140/6008. Large acft with wingspan greater than 78' may not use Twy A or Rwy 05-23 for simultaneous ops.

Mountain approximately 1280' MSL located 2.8 NM from threshold Rwy 05 on extended centerline. Standing water/ponding on Rwy 17-35 near Twy Echo during inclement weather. LAWRS avbl from twr personnel 1600-0500Z.

AIRPORT MANAGER: 808-281-9898**WEATHER DATA SOURCES:** ASOS (808) 865-6936**COMMUNICATIONS:** CTAF 125.7 ATIS 128.2**MOLOKAI RCO** 122.1R 116.1T (HONOLULU RADIO)® **HCF CENTER APP/DEP CON** 124.1**TOWER** 125.7 (1600-0430Z) **GND CON** 121.9**CLEARANCE DELIVERY PHONE:** For CD when ATCT is clsd ctc Honolulu Control Facility at 808-840-6262.**AIRSPACE:** CLASS D svc 1600-0430Z; other times CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MKK.**(H) (H) VORTAC** 116.1 MKK Chan 108 N21°08.29' W157°10.05' 067° 4.1 NM to fld. 1421/11E.

VORTAC unusable:

275°-285° byd 25 NM blo 3,500'

