

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE IPL.

IMPERIAL (VH) (H) VORTAC 115.9 IPL Chan 106 N32°44.93' W115°30.51' 344° 14.6 NM to fld. -18/14E.

VOR unusable:

001°-052° byd 40 NM

240°-252° byd 40 NM

253°-267° byd 40 NM blo 8,400'

253°-267° byd 54 NM

274°-284° byd 40 NM

BRIDGEPORT

BRYANT FLD (O57) 0 NE UTC-8(-7DT) N38°15.88' W119°13.36'

SAN FRANCISCO

6472 B TPA-7172(700) NOTAM FILE RAL

L-9A

RWY 16-34: H3854X60 (ASPH) S-30 MIRL

RWY 16: Rgt ttc.

RWY 34: Road.

SERVICE: LGT ACTIVATE MIRL Rwy 16-34-122.8.

AIRPORT REMARKS: Unattended. Rotating bcn located 1/4 mile E of the arpt on top of hill. Birds tend to congregate at N end of rwy. Arpt located in mountainous terrain. Hillside located 1644 ft east of AER 34 and 1815 ft east of AER 16. Vehicles on hwy parallel to rwy 180 ft east of AER 16 to midfield. Several unlit 40-80' trees are at 225-550' east of the rwy cntrln along the south two thirds of the rwy. Rwy 16-34 ptn of rwy cntrln obscd by crack fill.

AIRPORT MANAGER: 760-932-5452

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Oakland ARTCC at 510-745-3380.

RADIO AIDS TO NAVIGATION: NOTAM FILE RNO.

MINA (VH) (H) VORTAC 115.1 MVA Chan 98 N38°33.92'

W118°01.97' 236° 58.9 NM to fld. 7860/17E.

TACAN AZIMUTH unusable:

130°-160° byd 28 NM blo 10,700'

DME unusable:

130°-160° byd 28 NM blo 10,700'

VOR unusable:

035°-055° byd 40 NM


130°-135° byd 40 NM

130°-160° byd 28 NM blo 10,700'

150°-165° byd 40 NM

180°-185° byd 40 NM

250°-255° byd 40 NM

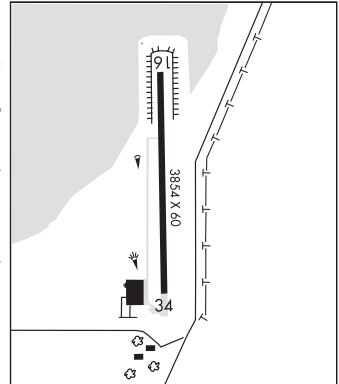

BROWN FLD MUNI (See SAN DIEGO on page 269)

BRYANT FLD (See BRIDGEPORT on page 125)

BUCHANAN FLD (See CONCORD on page 144)