REPUBLIC

FERRY CO (R49) 6 NE UTC–8(–7DT) N48º43.09´ W118º39.39´ **SEATTLE**
2522 B TPA—3322(800) NOTAM FILE SEA **L–13A**

RWY 17–35: H3498X60 (ASPH) MIRL
RWY 17: Trees. Rgt tfc.
RWY 35: PAPI(P2L)—GA 4.0º TCH 40´. Trees.

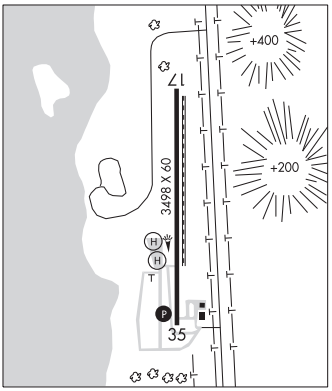

SERVICE: **LGT** ACTVT PAPI Rwy 35; MIRL Rwy 17–35—122.8.
AIRPORT REMARKS: Unattended. Suggest ngt ldgs be made on Rwy 35. Rwy 17–35 trees located on unlgtd unmarked mountainous terrain. P–lines NE of Rwy 17 lgtd dusk–dawn. Wildlife invof of rwy. Rwy 17 and Rwy 35 rwy mrkgs faded.
AIRPORT MANAGER: 616 822-0483
COMMUNICATIONS: CTAF 122.9
CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.
RADIO AIDS TO NAVIGATION: NOTAM FILE EPH.
EPHRATA (VH) (H) VORTACW 112.6 EPH Chan 73 N47º22.68´ W119º25.44´ 360º 86.2 NM to fld. 1250/21E.
VOR unusable:
010º–014º byd 40 NM
042º–054º byd 40 NM
214º–228º byd 40 NM blo 7,000´
214º–228º byd 52 NM blo 10,000´
214º–228º byd 77 NM
229º–247º byd 40 NM
310º–350º byd 25 NM blo 6,500´
310º–353º byd 40 NM
358º–004º byd 40 NM
TACAN AZIMUTH unusable:
280º–295º byd 25 NM blo 7,000´
310º–350º byd 25 NM blo 6,500´
DME unusable:
280º–295º byd 25 NM blo 7,000´
310º–350º byd 25 NM blo 6,500´

• • • • • • • • • • • • • • • • • •

HELIPAD H1: H20X20 (CONC)
HELIPAD H2: H20X20 (CONC)