SALINAS MUNI (SNS)(KSNS) 3 SE UTC–8(–7DT) N36°39.74´ W121°36.43´ **SAN FRANCISCO**
84 B TPA—884(800) NOTAM FILE SNS **H–3B, L–3B**
RWY 08–26: H6004X150 (ASPH) S–80, D–136, 2D–244 MIRL **IAP, AD**
RWY 08: VASI(V2L)—GA 3.0° TCH 53´. Thld dsplcd 396´. Rgt tfc.
RWY 26: REIL. VASI(V2L)—GA 3.0° TCH 43´.
RWY 13–31: H4825X150 (ASPH) S–120, D–235, 2S–127, 2D–401, 2D/2D2–935 HIRL
RWY 13: REIL. VASI(V4L)—GA 3.0° TCH 50´. RVR–R Trees.
RWY 31: MALSR. PAPI(P2L)—GA 3.0° TCH 59´. RVR–T Rgt tfc.

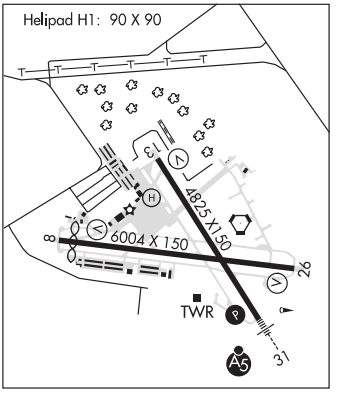

SERVICE: S4 **FUEL** 100LL, JET A **OX** 3 **LGT** When ATCT clsd ACTVT MALSR Rwy 31; REIL Rwy 13 and Rwy 26; PAPI Rwy 31; HIRL Rwy 13–31; MIRL Rwy 08–26, H1—CTAF. VASI Rwy 08, Rwy 13 and Rwy 26 opr consly.
AIRPORT REMARKS: Attended continuously. Portions of Twy B between D and N limited twr svc provided. 6´ tall security fence 400´ prior to Rwy 13 thld on centerline and steeply descending terrain 350´ prior to Rwy 31 thld on centerline both in Rwy 13–31 safety area. NOTE: See Special Notices—California Condors.
AIRPORT MANAGER: 831-758-7214
WEATHER DATA SOURCES: ASOS (831) 422–2830 LAWRS.
COMMUNICATIONS: CTAF 119.525 **UNICOM** 123.00 **ATIS** 124.85
Ⓡ **NORCAL APP/DEP CON** 133.0 (001°–135° MRY)
TOWER 119.525 (1400–0300Z‡ Oct–Mar; 1300–0300Z‡ Apr–Sep) **GND CON** 121.7
CLEARANCE DELIVERY PHONE: For CD when ATCT is clsd ctc NorCal Apch at 916-361-3748.
AIRSPACE: CLASS D svc 1400–0300Z‡ Oct–Mar, 1300–0300Z‡ Apr–Sep; other times CLASS G.
RADIO AIDS TO NAVIGATION: NOTAM FILE SNS.
(VH) (H) VORTACW 117.3 SNS Chan 120 N36°39.83´ W121°36.19´ at fld. 81/17E.
VOR unusable:
010°–016° byd 22 NM blo 7,000´
010°–016° byd 26 NM blo 8,000´
016°–080° byd 22 NM blo 8,000´
109°–119° byd 40 NM blo 6,000´
109°–119° byd 58 NM
135°–250° byd 40 NM
150°–170° byd 8 NM blo 10,000´
295°–302° byd 40 NM
303°–313° byd 40 NM blo 18,000´
314°–338° byd 40 NM
339°–349° byd 40 NM blo 18,000´
350°–108° byd 40 NM
TACAN AZIMUTH unusable:
010°–080° byd 22 NM blo 8,000´
150°–200° blo 11,000´
245°–255° byd 20 NM
Aerobatic acft wi an area defined as 0.5 NM rds of SNS 357016.4 (5.3 NM W CVH), blo 3000´, avoidance advised SR–SS
DME unusable:
010°–080° byd 22 NM blo 8,000´
150°–200° blo 11,000´
ILS 108.5 I–SNS Rwy 31. Class IB. Unmonitored when ATCT clsd.

• • • • • • • • • • • • • • • • • • •

HELIPAD H1: H90X90 (ASPH–CONC–AFSC)

SALTON CITY

SALTON SEA (SAS)(KSAS) 1 SW UTC–8(–7DT) N33°14.47´ W115°57.16´ **LOS ANGELES**
–84 TPA—716(800) NOTAM FILE SAN
RWY 07–25: 5000X75 (GRVL) S–28
RWY 07: Rgt tfc.
AIRPORT REMARKS: Unattended. Loose gravel in vicinity of parking area. Occasional ultralight activity on weekends.
AIRPORT MANAGER: (909) 429-4200
COMMUNICATIONS: CTAF 122.9
Ⓡ **YUMA APP/DEP CON** 132.275
CLEARANCE DELIVERY PHONE: For CD ctc Yuma CERAP at 928-269-9569.

SALTON SEA (See SALTON CITY on page 264)