


**AKRON—CANTON RGNL** (CAK)(KCAK) P (ARNG) 10 SE UTC-5(-4DT) N40°54.90' W81°26.62'  
 1226 B LRA ARFF Index—See Remarks NOTAM FILE CAK MON Airport  
 RWY 05-23: H8204X150 (ASPH-GRVD) S-120, D-160, 2S-175,  
 2D-250 PCR 410 F/B/XU HIRL

**DETROIT**  
 H-10G, L-29B  
 IAP, AD

RWY 05: MALSR. PAPI(P4L)—GA 3.0° TCH 50'. RVR-TR 0.5% up.  
 RWY 23: MALSR. PAPI(P4L)—GA 3.0° TCH 47'. RVR-TR 0.6% down.  
 RWY 01-19: H7601X150 (ASPH-GRVD) S-120, D-160, 2S-175,  
 2D-250 PCR 410 F/B/XU HIRL  
 RWY 01: MALSR. RVR-TR  
 RWY 19: MALSR. PAPI(P4L)—GA 3.0° TCH 53'. RVR-TR Thld dsplcd  
 601'.

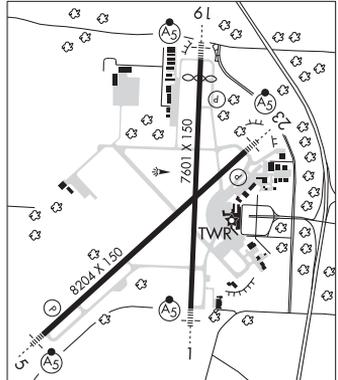

**LAND AND HOLD—SHORT OPERATIONS**

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
RWY 05	01-19	5723
RWY 19	05-23	3100

**RUNWAY DECLARED DISTANCE INFORMATION**

RWY 01:	TORA-7601	TODA-7601	ASDA-7007	LDA-7007
RWY 05:	TORA-8204	TODA-8204	ASDA-8204	LDA-8204
RWY 19:	TORA-7601	TODA-7601	ASDA-7601	LDA-7007
RWY 23:	TORA-8204	TODA-8204	ASDA-8204	LDA-8204

SERVICE: S4 FUEL 100LL, JET A OX 1, 2 MILITARY— FUEL A, A+  
 (C330-494-6104) (NC-100LL).

**AIRPORT REMARKS:** Attended continuously. All acft taxing on Air Camis Ramp and north hangar areas not visible from twr. Deer and birds on and invof arpt. Class I, ARFF Index B, ARFF svc not avbl 0100-0500 local (0600-1000Z) daily. One hour PPR for unsked air carrier ops, call arpt manager 330-499-4059. Twy E east of Twy B clsd to acft over 118' wingspan. Non-commercial landing fee: multi-engine only. Flight Notification Service (ADCUS) avbl. NOTE: See Special Notices—Arrival Alert.

**AIRPORT MANAGER:** 330-754-5233

**WEATHER DATA SOURCES:** ASOS (330) 227-8682

**COMMUNICATIONS:** ATIS 121.05 UNICOM 122.95

Ⓡ CLEVELAND APP/DEP CON 118.6 (187°-006°) 125.5 (007°-186°) (1100-0600Z)

Ⓡ CLEVELAND CENTER APP/DEP CON 134.9 (0600-1100Z) ctc Cleveland ARTCC at 440-774-0223.

TOWER 134.75 GND CON 121.7 CLNC DEL 132.05

ARNG OPS 40.1 138.55 226.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Cleveland ARTCC at 440-774-0223.

**AIRSPACE:** CLASS C svc ctc APP CON svc 1100-0600Z; other times CLASS D.

**VOR TEST FACILITY (VOT)** 110.6

**RADIO AIDS TO NAVIGATION:** NOTAM FILE CAK.

(L) (L) VORW/DME 114.4 ACO Chan 91 N41°06.47' W81°12.09' 228° 16.0 NM to fld. 1197/4W.

DME unusable:

Byd 10 NM

ILS 109.5 I-CAK Rwy 01. Class IA.

ILS/DME 108.3 I-EQX Chan 20 Rwy 05. Class IE.

ILS 109.5 I-RGO Rwy 19. Class IE.

ILS/DME 108.3 I-GGZ Chan 20 Rwy 23. Class IE. DME unusable byd 3° r of course.

**MAYFIELD** (1D4) 5 SE UTC-5(-4DT) N40°59.55' W81°25.91'

**DETROIT**

1100 NOTAM FILE CLE

RWY 09-27: 2315X110 (TURF) 0.3% up E

RWY 09: Thld dsplcd 180'. Trees.

RWY 27: Thld dsplcd 590'. Trees. Rgt tfc.

**AIRPORT REMARKS:** Attended irregularly. Deer, birds, and wildlife on and invof airport. Student ops NA; ngt ops NA. Rwy 09-27 rolling trrn upslp to the West; West end 12' hyr than East end. Open to the public, wx and conds prmtg, ldg fees. No prkg, fees may apply. No UAS, or similar acft prmtd. No unauthorized vehicles, no trespassing. Rwy 09-27 mkd with yellow tires and cones at rwy end and dthr only. Rwy 09-27 thr and dthr mrks not vsb fm 1000 ft AGL; no bdry mkr.

**AIRPORT MANAGER:** 330-699-3066

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Cleveland Apch at 216-352-2323, when Apch clsd ctc Cleveland ARTCC at 440-774-0223/0490.

**ALDERMAN** (See ST CLAIRSVILLE on page 312)

**ALEXANDER SALAMON** (See WEST UNION on page 325)