

NORTON MUNI (NRN)(KNRN) 1 N UTC-6(-5DT) N39°51.03' W99°53.68'

2384 B NOTAM FILE ICT

RWY 16-34: H4701X60 (CONC) HIRL 0.5% up NW**RWY 16:** REIL. PAPI(P2L)—GA 3.0° TCH 44'.**RWY 34:** REIL. PAPI(P2L)—GA 3.0° TCH 43'.**RWY 08-26:** 2117X125 (TURF)**RWY 08:** Trees.**SERVICE:** FUEL 100LL, JET A, A1+ LGT HIRL Rwy 16-34 opr consly.

ACTVT PAPI Rwy 16 and 34—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z†. Fuel 24 hr self-serve. No line of sight between rwy ends. Rwy 08-26 sfc rough.

Rwy 16-34 rwy sfc rough due to uneven paving joints every 10 ft.

AIRPORT MANAGER: 785-877-2201**WEATHER DATA SOURCES:** AWOS-3PT 118.275 (785) 871-4009.**COMMUNICATIONS:** CTAF 122.9

® DENVER CENTER APP/DEP CON 132.7

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HLC.**HILL CITY (VH) (H) VORTACW** 113.7 HLC Chan 84 N39°15.52'

W100°13.55' 015° 38.7 NM to fld. 2690/8E.

VOR unusable:

271°-274° byd 40 NM

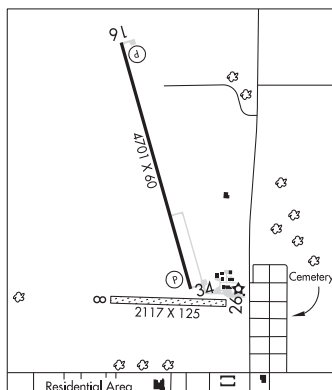
279°-289° byd 40 NM blo 4,800'

279°-289° byd 47 NM

WICHITA

L-10H

IAP

**NORWICH** (49K) 1 E UTC-6(-5DT) N37°27.33' W97°50.02'

1494 NOTAM FILE ICT

RWY 17-35: 3230X80 (TURF) LIRL(NSTD)**RWY 17:** P-line.**RWY 35:** Thld dsplcd 180'. Railroad.**SERVICE:** LGT NSTD LIRL Rwy 17-35, incorrect spacing.**AIRPORT REMARKS:** Unattended. Rwy 35 dsplcd thld mkd with 2 lgts each side with painted tires. Irrigation pump and fuel tank 75' left of cntrln Rwy 17 150' S of thld. Power line Rwy 17 apch mkd with orange balls.**AIRPORT MANAGER:** 620-704-3339**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Wichita Apch at 316-350-1520.

WICHITA

OAKLEY MUNI (OEL)(KOEL) 2 SE UTC-6(-5DT) N39°06.71' W100°49.01'

3045 B NOTAM FILE ICT

RWY 16-34: H5000X75 (CONC) S-30 MRL 0.5% up NW**RWY 16:** REIL. PAPI(P2L)—GA 3.0° TCH 44'. Bldg.**RWY 34:** REIL. PAPI(P2L)—GA 3.0° TCH 44'.**RWY 08-26:** 2153X110 (TURF)**RWY 26:** Road.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 16:** TORA-5000 TODA-5000 ASDA-5000 LDA-5000**RWY 34:** TORA-5000 TODA-5000 ASDA-5000 LDA-5000**SERVICE:** S4 FUEL 100LL, JET A, A1+ LGT ACTVT REIL Rwy 16 and

Rwy 34; PAPI Rwy 16 and Rwy 34; MRL Rwy 16-34—CTAF. Rwy

16 PAPI unusable byd 8° right and 6° left of centerline. Rwy 34 PAPI

unusable beyond 8° left of centerline.

AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z†. For svc after hrs call 785-672-0147. Fuel 24 hrs self-serve.**AIRPORT MANAGER:** 785-672-0147**WEATHER DATA SOURCES:** AWOS-3 118.325 (785) 671-4194.**COMMUNICATIONS:** CTAF/UNICOM 122.8

® DENVER CENTER APP/DEP CON 132.7

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HLC.**HILL CITY (VH) (H) VORTACW** 113.7 HLC Chan 84 N39°15.52' W100°13.55' 244° 28.9 NM to fld. 2690/8E.

VOR unusable:

271°-274° byd 40 NM

279°-289° byd 40 NM blo 4,800'

279°-289° byd 47 NM

WICHITA

H-5B, L-10G

IAP

