

**BELLINGHAM****BELLINGHAM INTL** (BLI)(KBLI) 3 NW UTC-8(-7DT) N48°47.56' W122°32.25'

171 B TPA—See Remarks AOE Class I, ARFF Index B NOTAM FILE BLI

**RWY 16-34:** H6700X150 (ASPH-GRVD) S-75, D-160, 2S-175,

2D-250 PCR 739 F/D/X/T HIRL

**RWY 16:** MALSR. PAPI(P4L)—GA 3.0° TCH 50'. RVR-T Rgt t/c.**RWY 34:** REIL. PAPI(P4L)—GA 3.0° TCH 50'. RVR-R**RUNWAY DECLARED DISTANCE INFORMATION****RWY 16:** TORA-6700 TODA-6700 ASDA-6700 LDA-6700**RWY 34:** TORA-6700 TODA-6700 ASDA-6700 LDA-6700**SERVICE:** S7 FUEL 100LL, JET A LGT When ATCT clsd ACTVT MALSR

Rwy 16; REIL Rwy 34; HIRL Rwy 16-34—CTAF.

**NOISE:** Noise abatement proc in efct ctc ops at 360-739-1944.**AIRPORT REMARKS:** Attended continuously. Birds and wildlife on and in/ov

arpt. PPR for unskd air carrier ops gtr than 30 pax

seats—360-739-1944. Twy A btn Twy E and Twy F clsd to wingspan

gtr than 118'. Portions of Twy A at Twy G and Twy J not vsbl fm ATCT.

Air carrier ops use Twy A, Twy B, Twy C, Twy D West of Twy E, Twy E,

Twy F West of Twy A, Twy G, and Twy H. Coml ramp clsd to pvt acft.

TPA—1200 (1030) fixed wing, 700(530) helicopter, 2000(1830)

turbo. Ldg fee ovr 7,500 lbs. Flight Notification Service (ADCUS) avbl.

**AIRPORT MANAGER:** 360-676-2500**WEATHER DATA SOURCES:** ASOS (360) 671-8688**COMMUNICATIONS:** CTAF 124.9 ATIS 134.45 360-647-5939 UNICOM 122.95

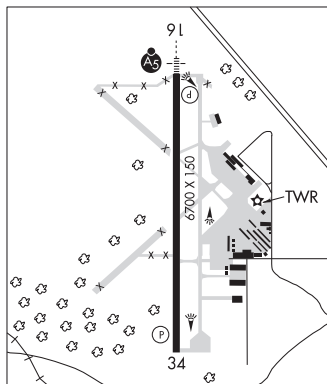
RCO 122.15 (SEATTLE RADIO)

® **VICTORIA TERMINAL APP/DEP CON** 132.7**TOWER** 124.9 (1500-0630Z) **GND CON** 127.4**CLEARANCE DELIVERY PHONE:** For CD when ATCT is clsd, ctc Victoria trml on 132.7 or at 604-586-4561.**AIRSPACE:** CLASS D svc 1500-0630Z; other times CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE BLI.**WHATCOM (H) TACAN** Chan 77 HUH (113.0) N48°56.72' W122°34.76' 150° 9.3 NM to fld. 82/20E.**TACAN AZIMUTH** unusable:

155°-165° byd 15 NM blo 6,000'

**ILS/DME** 108.5 I-BLI Chan 22 Rwy 16. Class IA. DME unusable byd 20° left of course. LOC unusable blw 300'

wi 0.3 NM and byd 34° left of course.

**SEATTLE****H-1B, L-1E****IAP, AD****FLOATHAVEN SPB** (ØW7) 6 SE UTC-8(-7DT) N48°44.14' W122°20.40'

307 NOTAM FILE SEA

**WATERWAY 12W-30W:** 10000X4000 (WATER)**SERVICE:** S4**NOISE:** Avoid flying over noise sensitive area during tkf and ldg.**SEAPLANE REMARKS:** Attended dalgt hrs. Canoe, sailboat, drone and hang glider activity in/ov arpt. For airframe repairs call

206-909-4783 prior to arr to arrg svcs. Land and tkf in the center of the lake.

**AIRPORT MANAGER:** 206-909-4783**COMMUNICATIONS:** CTAF 122.9**VICTORIA TERMINAL APP/DEP CON** 132.7 290.8 604-586-4560**SEATTLE****BOEING FLD/KING CO INTL** (See SEATTLE on page 269)**BOWERMAN FLD** (See HOQUIAM on page 241)**BOWERS FLD** (See ELLENSBURG on page 234)