

WAAS CH 47267 W35A	APP CRS 347°	Rwy Ldg 2640 TDZE 131 Apt Elev 143
--	------------------------	---

RNAV (GPS) RWY 35

MERRILL FLD (MRI) (PAMR)

RNP APCH - GPS.





When local altimeter setting not received, use ANC/PANC altimeter setting and increase all MDAs 20 feet. Procedure NA at night.
Rwy 35: Helicopter visibility reduction below 1 SM NA.


MISSED APPROACH: Climbing left turn to 2000 direct BGQ VORTAC and hold.

ATIS 124.25	ANCHORAGE APP CON 119.1 363.2	MERRILL TOWER ★ 126.0 (CTAF) 0	GND CON 121.7	UNICOM 122.95
-----------------------	---	--	-------------------------	-------------------------

MISSED APCH FIX

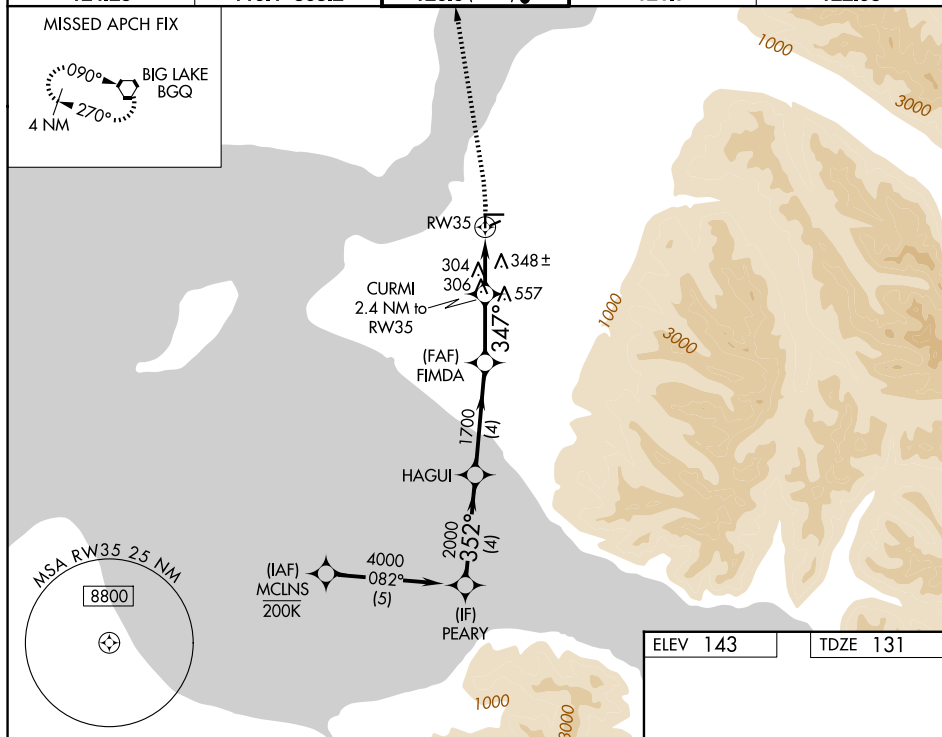

ELEV 143		TDZE 131
----------	--	----------

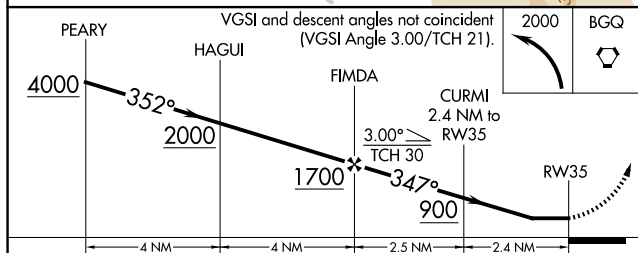

CATEGORY	A	B	C	D
LP MDA	560-1	429 (500-1)	NA	
LNAV MDA	600-1	469 (500-1)	NA	
CIRCLING	740-1 597 (600-1)	800-1 657 (700-1)	NA	

