

BRANSON**BRANSON** (BBG)(KBBG) 8 SSE UTC-6(-5DT) N36°31.92' W93°12.03'**KANSAS CITY**

1302 B Class I, ARFF Index A NOTAM FILE BBG

H-6I, L-16F**RWY 14-32:** H7140X150 (CONC-GRVD) S-75, D-200, 2S-175,
2D-350, 2D/2D2-700 PCR 510 R/C/W/T HIRL 0.7% up SE**IAP, AD****RWY 14:** REIL. PAPI(P4L)—GA 3.0° TCH 51'. Rgt tfc.**RWY 32:** MALSF. PAPI(P4L)—GA 3.0° TCH 50'.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 14:** TORA-7140 TODA-7140 ASDA-7140 LDA-7140**RWY 32:** TORA-7140 TODA-7140 ASDA-7140 LDA-7140**SERVICE:** FUEL 100LL, JET A, A+ LGT When ATCT clsd; ACTVT MALSF

Rwy 32; REIL Rwy 14; PAPI Rwy 14 and 32; HIRL Rwy 14-32—CTAF.

AIRPORT REMARKS: Attended continuously. Birds invof arpt. 100LL credit card self svc avbl H24 at GA apron. Arpt clsd to unskd ACR more than 30 pax seats exc 4 hr PPR—417-334-8002. PPR ACR more than 15 min bfr or aft sked arr or dep—amgr. Rwy 32 calm wind rwy. Hills and uneven trm invof; trrn avoidance may actvt on fnl.**AIRPORT MANAGER:** 417-334-7813**WEATHER DATA SOURCES:** AWOS-2 124.625 (417) 334-0218.**COMMUNICATIONS:** CTAF 128.15 ATIS 124.625 UNICOM 122.95® **SPRINGFIELD APP/DEP CON** 126.35**TOWER** 128.15 (1300-0300Z±) **GND CON** 118.4 **CLNC DEL** 118.4 126.35
(when twr clsd)**AIRSPACE:** CLASS D svc 1300-0300Z±; other times CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HRO.**HARRISON (VL) (L) VORW/DME** 112.5 HRO Chan 72 N36°19.10' W93°12.80' 359° 12.8 NM to fld. 1400/4E.

DME unusable:

245°-260° byd 30 NM blo 4,500'

VOR unusable:

000°-086° byd 40 NM

087°-097° byd 40 NM blo 3,000'

087°-097° byd 55 NM

098°-166° byd 40 NM

165°-215° byd 20 NM blo 5,000'

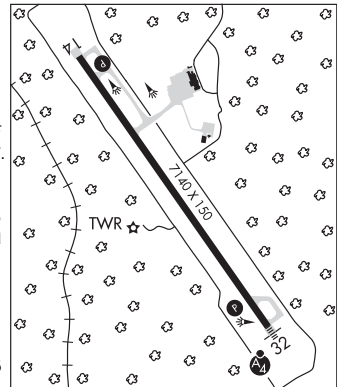
165°-215° byd 30 NM blo 6,500'

167°-177° byd 40 NM blo 10,000'

167°-177° byd 69 NM

178°-250° byd 40 NM

300°-359° byd 40 NM

ILS/DME 111.35 I-BBG Chan 50(Y) Rwy 32. Unmonitored when twr clsd.**M GRAHAM CLARK DOWNTOWN** (PLK)(KPLK) 1 S UTC-6(-5DT) N36°37.56' W93°13.74'**KANSAS CITY**

940 B NOTAM FILE COU

L-16F**RWY 12-30:** H3738X100 (ASP-GRVD) S-70, D-100 MIRL**IAP****RWY 12:** REIL. Thld dsplcd 289'.**RWY 30:** REIL. VASI(V4R)—GA 3.0° TCH 52'. Thld dsplcd 310'.**SERVICE:** S2 FUEL 100LL, JET A+ LGT ACTVT REIL Rwy 12 and 30;
VASI Rwy 30; MIRL Rwy 12-30—CTAF. Rwy 12 REIL located 105'
from dthr. Rwy 30 REIL located 86' from dthr.**AIRPORT REMARKS:** Attended 1300-2300Z±. Deer on and invof arpt.Student training activities in the area. General aviation svcs east end of
airfield. No safety/overrun areas at rwy ends—large drop-offs. Steep
terrain gradients along rwy pavement edges.**AIRPORT MANAGER:** 417-332-1848**COMMUNICATIONS:** CTAF/UNICOM 122.7**POINT LOOKOUT RCO** 122.2 (COLUMBIA RADIO)® **SPRINGFIELD APP/DEP CON** 126.35**CLEARANCE DELIVERY PHONE:** For CD ctc Springfield Apch at
417-868-5620/5619.**RADIO AIDS TO NAVIGATION:** NOTAM FILE COU.**DOGWOOD (VL) (L) VORTAC** 109.4 DGD Chan 31 N37°01.41'

W92°52.62' 215° 29.2 NM to fld. 1600/1E.

VOR unusable:

032°-042° byd 40 NM

284°-294° byd 21 NM blo 12,000'

284°-294° byd 9 NM blo 6,000'

285°-296° byd 40 NM

