

ADIRONDACK RGNL (See SARANAC LAKE on page 240)

AIRHAVEN (See STAATSBURG on page 247)

AIRLANE ENTERPRISES (See CLAY on page 194)

AKRON/JESSON FLD (9G3) 1 E UTC-5(-4DT) N43°01.27' W78°28.96'

DETROIT
L-31E
IAP

840 B NOTAM FILE BUF

RWY 07-25: H3268X75 (ASPH) S-8 MIRL 0.3% up NE

RWY 07: PAPI(P2L)—GA 4.0° TCH 54'. Trees.

RWY 25: REIL. PAPI(P2L)—GA 4.0° TCH 55'. Trees.

SERVICE: FUEL 100LL LGT ACTVT PAPI Rwy 07 & 25, REIL Rwy 25; MIRL Rwy 07-25—CTAF. Rwy 07 VGSJ unusbl byd 7 degs right of cntrln.

NOISE: Rwy 25 noise abatement—mntn rwy hdg til 3/4 miles byd dep end Rwy 25 bfr turning.

AIRPORT REMARKS: Unattended. For atndtc call 716-864-5004. 100LL fuel 24 hr self svc. Call arpt mgr. Parallel twy lighted and 35' wide.

AIRPORT MANAGER: 716-542-4607

COMMUNICATIONS: CTAF/UNICOM 122.725

Ⓡ **BUFFALO APP/DEP CON** 126.15

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0490.


RADIO AIDS TO NAVIGATION: NOTAM FILE BUF.

BUFFALO (DH) DME 116.4 BUF Chan 111 N42°55.74' W78°38.78' 052° 9.1 NM to fld. 730.

DME unusable:

051°-085° byd 25 NM blo 4,500'

301°-050° byd 25 NM blo 3,500'

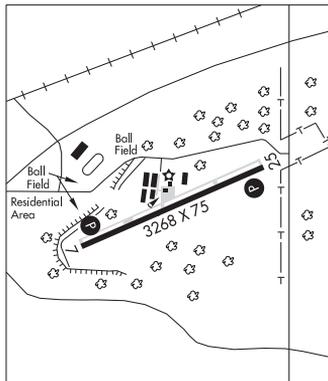

ALBANY INTL (ALB)(KALB) P (ARNG) 6 NW UTC-5(-4DT) N42°44.95' W73°48.12'

NEW YORK
H-101, 11C, 12K, L-32G, 33B, 34I
IAP, AD

285 B AOE Class I, ARFF Index C NOTAM FILE ALB

RWY 01-19: H8500X150 (ASPH-GRVD) S-140, D-200, 2D-400 PCR 508 F/D/X/T HIRL CL 0.3% down N

RWY 01: MALSR. TDZL. PAPI(P4R)—GA 3.0° TCH 53'. RVR-TR

RWY 19: MALSR. PAPI(P4L)—GA 3.0° TCH 53'. RVR-TR Tree.

RWY 10-28: H7200X150 (ASPH-GRVD) S-140, D-200, 2D-400 PCR 266 F/D/X/T HIRL CL

RWY 10: REIL. Ground.

RWY 28: REIL. PAPI(P4L)—GA 3.22° TCH 53'. Thld dsplcd 1192'. Tree.

LAND AND HOLD-SHORT OPERATIONS

LDG RWY	HOLD-SHORT POINT	AVBL LDG DIST
RWY 01	10-28	4150
RWY 28	01-19	3757

RUNWAY DECLARED DISTANCE INFORMATION

RWY 01: TORA-8500 TODA-8500 ASDA-8500 LDA-8500

RWY 10: TORA-7200 TODA-7200 ASDA-6780 LDA-6780

RWY 19: TORA-8500 TODA-8500 ASDA-8500 LDA-8500

RWY 28: TORA-7200 TODA-7200 ASDA-7200 LDA-6007

SERVICE: S4 FUEL 100LL, JET A OX3 FUEL (NC-100LL, A) FLUID HPOXR8

AIRPORT REMARKS: Attended continuously. Birds, deer and other wildlife on and invof arpt. Mowing wi safety areas of all rws and twys May thru Nov. Wx balloon launches aprxly 3 mi S of arpt at 1100Z± and 2300Z±. Twy C west of Twy A: non mov area. Twy D east of Rwy 01-19 rstrd to acct 12,500 lbs and less. No acct prkg btn fire stn and Twy L. Cust/lmg Flt Info Svc lctd N end GA apr. Acft clrg Cust use painted psn mks and procd to minimize blast impact. Ldg fee. Flight Notification Service (ADCUS) avbl. NOTE: See Special Notices—Arrival Alert.

AIRPORT MANAGER: 518-242-2384

WEATHER DATA SOURCES: ASOS 120.45 (518) 218-6284. LLWAS. WSP.

COMMUNICATIONS: D-ATIS 120.45 UNICOM 122.95

RCD 122.2 (BURLINGTON RADIO)

Ⓡ **APP/DEP CON** 118.05 (194°-011°) 132.825 (011°-194°)

TOWER 119.5 **GND CON** 121.7 **CLNC DEL** 127.5 **NG OPNS** 30.1 (FM) 122.775 258.2

PDC

AIRSPACE: CLASS C svc ctc APP CON.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

VOR TEST FACILITY (VOT) 108.2

RADIO AIDS TO NAVIGATION: NOTAM FILE ALB.

(L) (L) VORTACW 115.3 ALB Chan 100 N42°44.84' W73°48.19' at fld. 273/13W.

VOR unusable:

- 045°-065° byd 11 NM
- 066°-069° byd 11 NM blo 10,000'
- 078°-088° byd 20 NM blo 10,000'
- 109°-121°
- 121°-131° byd 30 NM
- 121°-131° wi 30 NM blo 9,900'
- 131°-168°
- 184°-189°
- 226°-269° byd 29 NM blo 15,000'
- 312°-315°
- 333°-343°

TACAN AZIMUTH unusable:

- 032°-042° byd 15 NM
- 164°-168°
- 303°-308° byd 37 NM
- 308°-333°

DME unusable:

- 303°-308° byd 37 NM

ILS/DME 109.5 I-DEJ Chan 32 Rwy 01. Class IIE.

ILS/DME 109.5 I-ALB Chan 32 Rwy 19. Class IB.

COMM/NAV/WEATHER REMARKS: Class C information avbl on ATIS frequency 20 NM.

ALBERT S NADER RGNL (See ONEONTA on page 233)

ALBION

PINE HILL (9G6) 5 SW UTC-5(-4DT) N43°10.41' W78°16.48'

669 TPA-2169(1500) NOTAM FILE BUF

RWY 10-28: H2659X36 (ASPH) S-12 0.6% up E

RWY 10: Tree.

RWY 28: Thld dsplcd 250'. Road.

AIRPORT REMARKS: Unattended. Parachute Jumping, 245' twr 1500' SSE AER 28.

AIRPORT MANAGER: 716-597-7393

COMMUNICATIONS: CTAF/UNICOM 123.0

Ⓡ BUFFALO APP/DEP CON 126.15

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0490.

RADIO AIDS TO NAVIGATION: NOTAM FILE BUF.


BUFFALO (DH) DME 116.4 BUF Chan 111 N42°55.74'

W78°38.78' 048° 22.0 NM to fld. 730.

DME unusable:

- 051°-085° byd 25 NM blo 4,500'
- 301°-050° byd 25 NM blo 3,500'

DETROIT
L-31E, 32F
IAP, AD

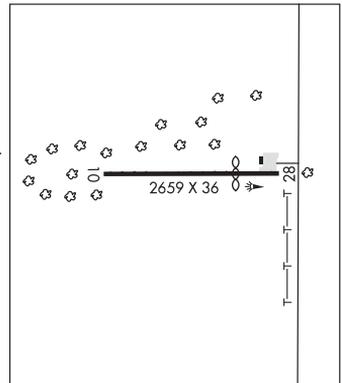

ALPINE N42°14.32' W76°45.84' NOTAM FILE ELM.

NDB (MHW) 245 ALP 242° 7.4 NM to Elmira/Corning Rgnl. 1287/12W.

NEW YORK
L-301, 32F

ARCADE TRI-COUNTY (D23) 2 N UTC-5(-4DT) N42°34.00' W78°25.57'

1745 NOTAM FILE BUF

RWY 09-27: 3220X60 (GRVL)

RWY 09: Trees.

RWY 27: Trees.

RWY 14-32: 2710X80 (TURF)

RWY 14: Trees.

RWY 32: Trees.

AIRPORT REMARKS: Unattended. PPR. Rwy 09-27 clsd Nov thru Apr. Rwy 14-32 clsd Oct thru May. Deer on and invof arpt.

AIRPORT MANAGER: 716-864-3354

COMMUNICATIONS: CTAF/UNICOM 123.0

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0490.

DETROIT