

ADIRONDACK RGNL (See SARANAC LAKE on page 241)

AIRHAVEN (See STAATSBURG on page 248)

AIRLANE ENTERPRISES (See CLAY on page 195)

AKRON/JESSON FLD (9G3) 1 E UTC-5(-4DT) N43°01.27' W78°28.96'

840 B NOTAM FILE BUF

RWY 07-25: H3268X75 (ASPH) S-8 MIRL 0.3% up NE

RWY 07: PAPI(P2L)—GA 4.0° TCH 54'. Trees.

RWY 25: REIL. PAPI(P2L)—GA 4.0° TCH 55'. Trees.

SERVICE: FUEL 100LL LGT ACTVT PAPI Rwy 07 & 25, REIL Rwy 25;

MIRL Rwy 07-25—CTAF. Rwy 07 VGSU unusbl byd 7 degs right of cntrln.

NOISE: Rwy 25 noise abatement—mntn rwy hdg til 3/4 miles byd dep end Rwy 25 bfr turning.

AIRPORT REMARKS: Unattended. For atndtc call 716-864-5004. 100LL fuel 24 hr self svc. Call arpt mgr. Parallel twy lighted and 35' wide.

AIRPORT MANAGER: 716-542-4607

COMMUNICATIONS: CTAF/UNICOM 122.725

® **BUFFALO APP/DEP CON** 126.15

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0490.

RADIO AIDS TO NAVIGATION: NOTAM FILE BUF.

BUFFALO (DH) DME 116.4 BUF Chan 111 N42°55.74'

W78°38.78' 052° 9.1 NM to fld. 730.

DME unusable:


051°-085° byd 25 NM blo 4,500'

301°-050° byd 25 NM blo 3,500'

DETROIT

L-31E

IAP

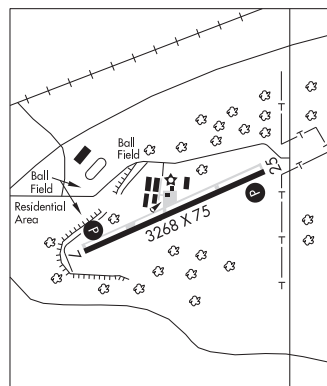

ALBANY INTL (ALB)(KALB) P (ARNG) 6 NW UTC-5(-4DT) N42°44.95' W73°48.12'

285 B AOE Class I, ARFF Index C NOTAM FILE ALB

RWY 01-19: H8500X150 (ASPH-GRVD) S-140, D-200, 2D-400 PCR 508 F/D/X/T HIRL

CL 0.3% down N

RWY 01: MALSR. TDZL. PAPI(P4R)—GA 3.0° TCH 53'. RVR-TR

RWY 19: MALSR. PAPI(P4L)—GA 3.0° TCH 53'. RVR-TR Tree.

RWY 10-28: H7200X150 (ASPH-GRVD) S-140, D-200, 2D-400 PCR 266 F/D/X/T HIRL CL

RWY 10: REIL. Ground.

RWY 28: REIL. PAPI(P4L)—GA 3.22° TCH 53'. Thld dspldc 1192'. Tree.

LAND AND HOLD—SHORT OPERATIONS

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
RWY 01	10-28	4150
RWY 28	01-19	3757

RUNWAY DECLARED DISTANCE INFORMATION

RWY 01: TORA-8500 TODA-8500 ASDA-8500 LDA-8500

RWY 10: TORA-7200 TODA-7200 ASDA-6780 LDA-6780

RWY 19: TORA-8500 TODA-8500 ASDA-8500 LDA-8500

RWY 28: TORA-7200 TODA-7200 ASDA-7200 LDA-6007

SERVICE: S4 FUEL 100LL, JET A OX3 FUEL (NC-100LL, A) FLUID HPOXRB

AIRPORT REMARKS: Attended continuously. Birds, deer and other wildlife on and in/ov arpt. Mowing wi safety areas of all rwys and twys May thru Nov. Wx balloon launches aprxly 3 mi S of arpt at 1100Z± and 2300Z±. Twy C west of Twy A: non mov area. Twy D east of Rwy 01-19 rstrd to acft 12,500 lbs and less. No acft prkg btn fire stn and Twy L. Cust/lmg Flt Info Svc lctd N end GA apr. Acft clrg Cust use painted psn mkgs and procd to minimize blast impact. Ldg fee. Flight Notification Service (ADCUS) avbl. NOTE: See Special Notices—Arrival Alert.

AIRPORT MANAGER: 518-242-2384

WEATHER DATA SOURCES: ASOS 120.45 (518) 218-6284. LLWAS. WSP.

COMMUNICATIONS: D-ATIS 120.45 UNICOM 122.95)

® **APP/DEP CON** 118.05 (194°-011°) 132.825 (011°-194°)

TOWER 119.5 **GND CON** 121.7 **CLNC DEL** 127.5 **NG OPNS** 30.1 (FM) 122.775 258.2

PDC

AIRSPACE: CLASS C svc ctc **APP CON**.

NEW YORK

H-101, 11C, 12K, L-326, 33B, 34I

IAP, AD

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

VOT TEST FACILITY (VOT) 108.2

RADIO AIDS TO NAVIGATION: NOTAM FILE ALB.

(L) (L) VORTACW 115.3 ALB Chan 100 N42°44.84' W73°48.19' at fld. 273/13W.

VOR unusable:

045°-065° byd 11 NM

066°-069° byd 11 NM blo 10,000'

078°-088° byd 20 NM blo 10,000'

109°-121°

121°-131° byd 30 NM

121°-131° wi 30 NM blo 9,900'

131°-168°

184°-189°

226°-269° byd 29 NM blo 15,000'

312°-315°

333°-343°

TACAN AZIMUTH unusable:

032°-042° byd 15 NM

164°-168°

303°-308° byd 37 NM

308°-333°

DME unusable:

303°-308° byd 37 NM

ILS/DME 109.5 I-DEJ Chan 32 Rwy 01. Class IIE.

ILS/DME 109.5 I-ALB Chan 32 Rwy 19. Class IB.

COMM/NAV/WEATHER REMARKS: Class C information avbl on ATIS frequency 20 NM.

ALBERT S NADER RGNL (See ONEONTA on page 234)

ALBION

PINE HILL (9G6) 5 SW UTC-5(-4DT) N43°10.41' W78°16.48'

669 TPA-2169(1500) NOTAM FILE BUF

RWY 10-28: H2659X36 (ASPH) S-12 0.6% up E

RWY 10: Tree.

RWY 28: Thld dsplcd 250'. Road.

AIRPORT REMARKS: Unattended. Parachute Jumping. 245' twr 1500' SSE.

AER 28. Rwy 10 number only, no cntrln. Rwy 28 number only, no cntrln, thld bar, or arrow heads.

AIRPORT MANAGER: 716-597-7393

COMMUNICATIONS: CTAF/UNICOM 123.0

® BUFFALO APP/DEP CON 126.15

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0490.

RADIO AIDS TO NAVIGATION: NOTAM FILE BUF.

BUFFALO (DH) DME 116.4 BUF Chan 111 N42°55.74'

W78°38.78' 048° 22.0 NM to fld. 730.

DME unusable:


051°-085° byd 25 NM blo 4,500'

301°-050° byd 25 NM blo 3,500'

DETROIT

L-31E, 32F

IAP, AD

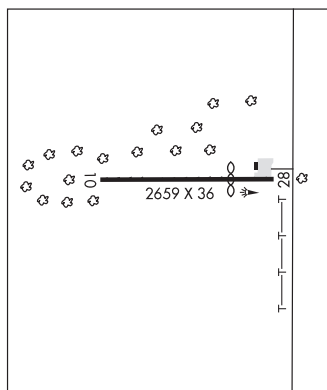

ALPINE N42°14.32' W76°45.84' NOTAM FILE ELM.

NDB (MHW) 245 ALP 242° 7.4 NM to Elmira/Corning Rgnl. 1287/12W.

NEW YORK

L-30J, 32F

ARCADE TRI-COUNTY (D23) 2 N UTC-5(-4DT) N42°34.00' W78°25.57'

1745 NOTAM FILE BUF

RWY 09-27: 3220X60 (GRVL)

RWY 09: Trees.

RWY 27: Trees.

RWY 14-32: 2710X80 (TURF)

RWY 14: Trees.

RWY 32: Trees.

AIRPORT REMARKS: Unattended. PPR. Rwy 09-27 clsd Nov thru Apr. Rwy 14-32 clsd Oct thru May. Deer on and invof arpt.

AIRPORT MANAGER: 716-864-3354

COMMUNICATIONS: CTAF/UNICOM 123.0

CLEARANCE DELIVERY PHONE: For CD ctc Cleveland ARTCC at 440-774-0490.

DETROIT