

**ROANOKE/BLACKSBURG RGNL (WOODRUM FLD)** (ROA)(KROA) 3 NW UTC-5(-4DT)

CINCINNATI

H-10H, 12H, L-26I

IAP, AD

N37°19.53' W79°58.53'

1175 B TPA-1975(800) Class I, ARFF Index B NOTAM FILE ROA

**RWY 06-24:** H6800X150 (ASPH-GRVD) S-150, D-200, 2S-175, 2D-310 PCR 530 F/B/X/T HIRL**RWY 06:** MALSR. REIL. VASI(V4L)-GA 3.0° TCH 58'.**RWY 24:** REIL. PAPI(P4L)-GA 3.0° TCH 58'. Thld dspclcd 790'.**RWY 16-34:** H5810X150 (ASPH-GRVD) S-150, D-200, 2S-175, 2D-310 PCR 484 F/A/X/T HIRL 0.4% up NW**RWY 34:** MALSR. PAPI(P4L)-GA 3.0° TCH 56'. Tower.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 06:** TORA-6800 TODA-6800 ASDA-6800 LDA-6800**RWY 16:** TORA-5810 TODA-5810 ASDA-5810 LDA-5810**RWY 24:** TORA-6800 TODA-6800 ASDA-6800 LDA-6010**RWY 34:** TORA-5810 TODA-5810 ASDA-5810 LDA-5810**ARRESTING GEAR/SYSTEM****RWY 34:** EMAS**SERVICE:** S4 FUEL 100LL, JET A OX 1, 2 LGT Rwy 24 PAPI unusbl byd 5 degs R of cntrln due to trrn.**AIRPORT REMARKS:** Attended continuously. Birds invof arpt. For opr concerns-ATCT 540-563-1307. Tkof and Indg per and rwy cond assessment matrix not mntd 0500-1030Z hrs dly. Dep Rwy 34 and arr Rwy 16 NA at night or during IFR cond due to trrn. Twy T clsd to acft with wingspan greater than 118 ft. Cold temperature airport. Altitude correction required at or below -12C. Tsnt pilots ctc FBO UNICOM for prkg and escort.**AIRPORT MANAGER:** 540-362-1999**WEATHER DATA SOURCES:** ASOS (540) 216-0158 LLWAS.**COMMUNICATIONS:** ATIS 132.375 UNICOM 122.95**ROANOKE RCO** 122.6 (LEESBURG RADIO)**(R) APP/DEP CON** 118.15 Rwy 16/34 (360°-150°) Rwy 06 (235°-074°) 133.225 Rwy 16/34 (151°-359°) Rwy 06 (075°-234°)**TOWER** 118.3 **GND CON** 121.9 **CLNC DEL** 119.7**AIRSPACE:** CLASS C svc ctc **APP CON** svc continuously.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ROA.**VINTON NDB (MHW)** 277 VIT N37°12.24' W79°52.90' 336° 8.6 NM to fld. 1543/8W.

NDB unusable:

Byd 11 NM

**LDA/DME** 111.1 I-SZK Chan 48 Rwy 06. Glideslope AIMED part to LOC course. DME unusable byd 30° left of course. LOC unusable wi 0.6 NM. ILS unusable blw 1,475'.**ILS** 109.7 I-ROA Rwy 34. Class IB.**SALUDA****HUMMEL FLD** (W75) 6 E UTC-5(-4DT) N37°36.22' W76°26.79'

WASHINGTON

L-34E, 36I

IAP

30 B NOTAM FILE DCA

**RWY 01-19:** H3150X50 (ASPH) S-12.5 MIRL**RWY 01:** PAPI(P2L)-GA 4.0° TCH 63'. Tree.**RWY 19:** PAPI(P2L)-GA 4.0° TCH 26'. Tree.**SERVICE:** S4 FUEL 100LL LGT ACTVTY MIRL Rwy 01-19-CTAF. PAPI Rwy 01 and Rwy 19 ops consly.**AIRPORT REMARKS:** Attended 1300-2100Z. Unattended Thanksgiving, Christmas Day and New Year's Day. Topping is city closest to the arpt. Arpt is 2 miles ENE. Drainage swales full length of rwy on both sides. Use of exit in front of Hummel Aviation advised. Birds and deer on and invof arpt during winter. Dep Rwy 01-19: Climb to 500 ft before any turn out; arr acft use wide pat to avoid populated areas east and west of arpt.**AIRPORT MANAGER:** 804-758-4330**WEATHER DATA SOURCES:** AWOS-3 118.45 (804) 758-8592.**COMMUNICATIONS:** CTAF/UNICOM 123.0**(R) NORFOLK APP/DEP CON** 126.05**CLEARANCE DELIVERY PHONE:** For CD ctc Norfolk Apch at 757-464-0757.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DCA.**HARCUM (L) (L) VORTACW** 108.8 HCM Chan 25 N37°26.92'

W76°42.68' 061° 15.7 NM to fld. 8/7W.

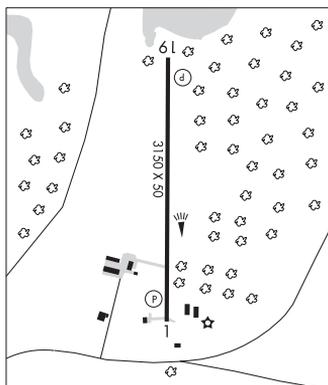
VOR unusable:

056°-095° blo 2,000'

096°-112° byd 20 NM

174°

275°-300° blo 2,000'

**SHANNON** (See FREDERICKSBURG on page 347)