

MERIDEN MARKHAM MUNI (MMK)(KMMK) 3 SW UTC-5(-4DT) N41°30.52' W72°49.77'**NEW YORK**

103 B NOTAM FILE MMK

L-33B, 34I

RWY 18-36: H3100X75 (ASPH) S-30 MIRL

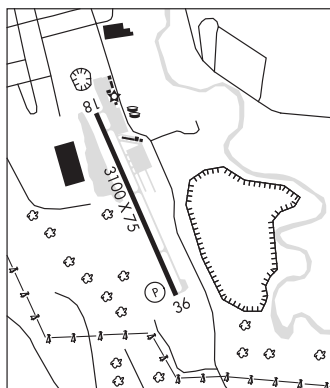
IAP

RWY 18: Tree.**RWY 36:** REIL. PAPI(P4L)—GA 3.5° TCH 38'. Tree.**SERVICE:** S4 **FUEL** 100LL **LGT** ACTIVATE MIRL Rwy 18-36 and REIL Rwy 36—CTAF.**AIRPORT REMARKS:** Attended Mon-Sun 1400-2200Z. Ctn deer, coyotes & birds on & invof arpt. 100LL self svc fuel. Cranes +150 ft AGL, 0.25 mi NW AER 18, lgtd oper intmt dalgt. PPR for jet. Rwy 36 no touch and go ldg. Std left ttc for both rws. Calm wind Rwy 18.**AIRPORT MANAGER:** 203-630-2878**WEATHER DATA SOURCES:** ASOS 134.925 (203) 639-9405.**COMMUNICATIONS:** CTAF/UNICOM 123.05® **BRADLEY APP/DEP CON** 127.8**CLNC DEL** 120.65**CLEARANCE DELIVERY PHONE:** For CD ctc Bradley Apch at 860-386-3597.**RADIO AIDS TO NAVIGATION:** NOTAM FILE BDR.**MADISON (L) (L) VORW/DME** 110.4 MAD Chan 41 N41°18.83'

W72°41.53' 345° 13.2 NM to fld. 216/13W.

DME unusable:

330°-090° byd 30 NM blo 4,000'

**MOUNT TOBE** (See WATERBURY on page 41)**NEW HAVEN****TWEED/NEW HAVEN** (HVN)(KHVN) 3 SE UTC-5(-4DT) N41°15.82' W72°53.26'**NEW YORK**

13 B TPA—See Remarks LRA ARFF Index—See Remarks NOTAM FILE HVN

H-10I, 12I, L-33B, 34I

RWY 02-20: H5600X150 (ASPH-GRVD) S-110, D-160, 2S-175 PCR 320 F/B/X/T HIRL

IAP, AD

RWY 02: MALSF, PAPI(P4L)—GA 3.0° TCH 50'. RVR-T Trees.**RWY 20:** PAPI(P4L)—GA 3.5° TCH 55'. RVR-R Trees.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 02:** TORA-5600 TODA-5600 ASDA-5600 LDA-5600**RWY 20:** TORA-5600 TODA-5600 ASDA-5600 LDA-5600**SERVICE:** S4 **FUEL** 100LL, JET A **OX** 1, 3 **LGT** When ATCT clsd ACTVT MALSF Rwy 02; HIRL Rwy 02-20—CTAF.**NOISE:** Noise abatement procedures in effect. Departing Rwy 20, right and left turn made only after passing shoreline. Clsd to acft over 78 dB 1200-0300Z, 73 dB 0300-0500Z and 1100-1200Z, 68 dB 0500-1100Z excp mil emerg and med acft; PPR call 203-907-9818.**AIRPORT REMARKS:** Attended 1100-0300Z. Wildlife frequently on or invof arpt. Fuel avbl after hrs PPR 203-467-9555. Class I, ARFF Index C. ARFF Index C svcs prvd btn 1100-0459Z dly. ARFF Index B svcs prvd drg otr times. For Index C svcs btn 0500-0959Z, 1 hr 30 min PPR at 203-907-9818. Touch and go ldg ops permitted 1200-0300Z Mon-Sat, 1300-0300Z Sun. Ldg helicopters use Twys A and H intxn. Standing water at intxn of Twy D and C aft hvy rain. PAEW adjacent to all operational sfcs dalgt hrs Apr-Oct. Extensive HOP sfc—10,000' within 20 miles north/northwest. TPA—1011 (999) reciprocating eng and 1511 (1499) Turboprop/Jet. Avoid close-in base legs and short apchs ldg Rwy 20. Tran parking on east ramp only. Ldg fee for all acft exc mil, government, emerg and medical. Flight Notification Service (ADCUS) available.**AIRPORT MANAGER:** 203-466-8833**WEATHER DATA SOURCES:** ASOS (203) 466-6205 LAWRS.**COMMUNICATIONS:** CTAF 124.8 ATIS 133.65 UNICOM 122.95® **NEW YORK APP/DEP CON** 124.075**TOWER** 124.8 (1100-0300Z) **GND CON** 121.7 **CLNC DEL** 121.7 (When twr clsd)**CLEARANCE DELIVERY PHONE:** For CD when twr clsd ctc New York Apch at 516-683-2449 or 121.7.**AIRSPACE:** CLASS D svc 1100-0300Z; other times CLASS G.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HVN.**NEW HAVEN (T) DME** 109.8 HVN Chan 35 N41°15.74' W72°53.11' at fld. 4.**DME unusable:**

031°-120° blo 4,000'

159°-254° blo 3,000'

ILS/DME 109.1 I-HVN Chan 28 Rwy 02. Class IB. Unmonitored when ATCT clsd.**NEW HAVEN** N41°15.74' W72°53.11' NOTAM FILE HVN.**NEW YORK**(T) **DME** 109.8 HVN Chan 35 at Tweed/New Haven. 4.

L-33B, 34I

DME unusable:

031°-120° blo 4,000'

159°-254° blo 3,000'