

BREWSTER

ANDERSON FLD (S97) 3 E UTC-8(-7DT) N48°06.28' W119°43.19'

SEATTLE
L-13A

920 B NOTAM FILE SEA

RWY 07-25: H4000X60 (ASPH) S-15 MIRL

SERVICE: LGT ACTIVATE MIRL Rwy 07-25—CTAF. Twy lgts on center twy only.

AIRPORT REMARKS: Unattended. Wind indicator lit in non-daylight hrs.

Pilots provide tie down ropes.

AIRPORT MANAGER: (509) 689-3464

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD etc Seattle ARTCC at 253-351-3694.

RADIO AIDS TO NAVIGATION: NOTAM FILE MWH.

MOSES LAKE (VH) (DH) VOR/DME 115.0 MWH Chan 97

N47°12.65' W119°19.01' 325° 56.1 NM to fld.

1193/18E.

VOR unusable:

025°-040° byd 40 NM

055°-070° byd 40 NM

071°-081° byd 40 NM blo 28,000'

175°-198° byd 40 NM blo 6,000'

175°-198° byd 67 NM blo 10,000'

175°-198° byd 70 NM


200°-210° byd 40 NM

220°-230° byd 40 NM

240°-253° byd 40 NM blo 18,000'

254°-260° byd 40 NM

315°-345° byd 40 NM

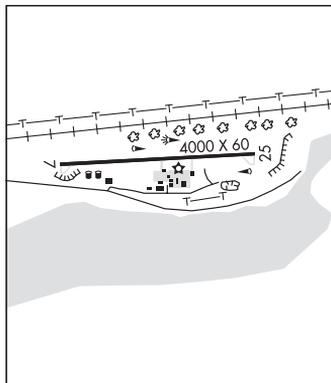

BUCKHORN MTN N46°32.49' W123°01.28'

RCO 122.2 (SEATTLE RADIO)

SEATTLE
L-1C

BURLINGTON/MOUNT VERNON

SKAGIT RGNL (BVS)(KBVS) 3 W UTC-8(-7DT) N48°28.23' W122°25.30'

SEATTLE
H-1B, L-1E
IAF

145 B TPA—See Remarks LRA NOTAM FILE BVS

RWY 11-29: H5480X100 (ASPH) S-60, D-75, 2D-125 MIRL

0.8% up W

RWY 11: REIL. PAPI(P4L)—GA 3.0° TCH 43'.

RWY 29: REIL. PAPI(P4L)—GA 3.0° TCH 42'.

RWY 04-22: H3000X60 (ASPH) S-12.5 LIRL 0.3% up NE

RWY 04: PAPI(P2L)—GA 4.0° TCH 43'.

RWY 22: PAPI(P2L)—GA 3.0° TCH 44'.

SERVICE: S4 FUEL 100LL JET A OX 3, 4 LGT ACTIVATE MIRL Rwy 11-29 and LIRL Rwy 04-22, PAPI Rwy 11 and Rwy 29 and REIL Rwy 11 and Rwy 29—CTAF. PAPI Rwy 04 and Rwy 22 opr continuously.


AIRPORT REMARKS: Attended 1500-0300Z. Migratory waterfowl and birds on and in/ov arpt. Helicopter training ops on arpt with autorotations on rwy. Rwy 04-22 CLOSED to acft more than 12,500 lbs and wingspan more than 49'. Terminal building open 1500-0300Z. After hours, access avbl to pilots. Terminal and apron adj to terminal free pilot access Wifi. Possible turbulence in/ov exhaust stacks 3,500' southwest of Rwy 04, avoid low alt over fit. Use of Twy B by acft with wingspan 49' or greater prohibited when Rwy 04-22 in use. TPA-1145(1000) Ultralight TPA-645(500). Rwy 04-22 has wdspr, opn, unsealed cracks and joints. Rwy 04 and Rwy 22 markings faded. U.S. Cust svc avbl for intl arr. Ck Port of Skagit website for req for svc instr, www.portofskagit.com. Avbl seve days a week, per avpl. Usage fees apply.

AIRPORT MANAGER: 360-757-0011

WEATHER DATA SOURCES: AWOS-3 121.125 (360) 757-7767.

COMMUNICATIONS: CTAF/UNICOM 123.075

® WHIDBEY APP/DEP CON 120.7

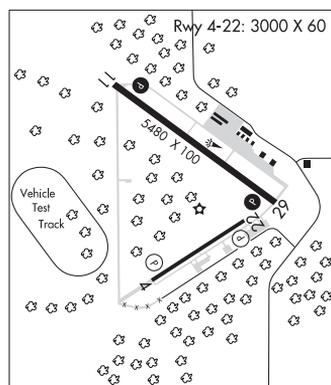

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

CLEARANCE DELIVERY PHONE: For CD ctc Whidbey Apch at 360-257-3310.

RADIO AIDS TO NAVIGATION: NOTAM FILE SEA.

TATOOSH (VH) (H) VORTACW 112.2 TOU Chan 59 N48°17.99' W124°37.62' 061° 88.8 NM to fld. 1650/22E.

VOR unusable:

020°-025° byd 40 NM
085°-090° byd 40 NM
091°-101° byd 40 NM blo 15,000'
091°-101° byd 58 NM
103°-109° byd 40 NM
356°-360° byd 40 NM

CAMANO ISLAND AIRFIELD (See STANWOOD on page 276)

CAMAS

GROVE FLD (1W1) 3 N UTC-8(-7DT) N45°37.67' W122°24.26'

SEATTLE

429 B TPA-1229(800) NOTAM FILE SEA

RWY 07-25: H2710X40 (ASPH) MIRL(NSTD)

RWY 07: Thld dsplcd 493'. Trees.

RWY 25: Thld dsplcd 413'. Trees.

SERVICE: FUEL 100, MOGAS **Lgt** Rwy 07-25 NSTD MIRL Rwy 07 and Rwy 25 dsplcd thlds unlighted. ACTIVATE rotating bcn and MIRL Rwy 07-25-CTAF.

NOISE: Noise abatement procedures in effect, ctc Port of Camas-Washougal at 360-835-2196.

AIRPORT REMARKS: Unattended. For fuel after hrs credit card lock. Rwy 07-25 has buildings, telephone poles and trees encroaching in safety areas.

AIRPORT MANAGER: 360-835-2196

COMMUNICATIONS: CTAF 122.7

CLNC DEL 121.65

CLEARANCE DELIVERY PHONE: For CD ctc Portland Apch at 503-493-7545.

CASHMERE-DRYDEN (8S2) 2 SW UTC-8(-7DT) N47°30.89' W120°29.08'

SEATTLE

858 B NOTAM FILE SEA

RWY 07-25: H1800X50 (ASPH) S-8 MIRL 1.4% up W

RWY 07: Trees.

RWY 25: Thld dsplcd 144'. Trees.

SERVICE: **Lgt** ACTIVATE MIRL Rwy 07-25; bcn-121.7.

AIRPORT REMARKS: Unattended. Ground vehicles and pedestrians use twy for hangar access. Exit rwy at twys only. Radio control model activity permitted on W end of arpt.

AIRPORT MANAGER: (509) 782-3321

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

CEDARS NORTH (See BATTLE GROUND on page 220)