

THATCHER

W E RANCH (ØID) 3 NW N42°26.89' W111°46.65' SALT LAKE CITY

5075 NOTAM FILE HUF

RWY 17-35: 1350X48 (GRVL)

RWY 17: Rgt tfc.

RWY 35: Rgt tfc.

AIRPORT REMARKS: Unattended. CTN: Psbl lrg wildlife on or invof rwy. Rwy 17-35 lctd on a plateau; sharp drop off near both rwy ends. No winter maint; use at own risk. Rwy 17-35 sfc rough due to heavy livestock tfc on rwy.

AIRPORT MANAGER: 801 440 6204

COMMUNICATIONS: CTAF 122.9

THOMAS CREEK (See STANLEY on page 85)

THREE CREEK

MURPHY HOT SPRINGS (3UØ) 9 W UTC-7(-6DT) N42°01.41' W115°20.13' SALT LAKE CITY

5829 NOTAM FILE BOI

RWY 01-19: 5250X120 (TURF) 1.2% up S

RWY 01: Fence.

RWY 19: Fence.

AIRPORT REMARKS: Unattended. No telephone avbl at arpt. No winter maint. No line of sight between rwy ends. Recommend land Rwy 19 and depart Rwy 01 when wind conditions permit. Yellow and black fence mrkg panels on apchs to Rwy 01 and 19. Rwy soft in spring and when wet, spcly first 2000 ft of Rwy 19. Rwy 01-19 edges and thlds marked with white rock.

AIRPORT MANAGER: 208-334-8775

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.

TWIN BRIDGES (See KETCHUM on page 61)

TWIN FALLS

JOSLIN FLD/MAGIC VALLEY RGNL (TWF)(KTWF) 4 S UTC-7(-6DT) N42°28.91' W114°29.26' SALT LAKE CITY

4153 B Class I, ARFF Index B NOTAM FILE TWF MON Airport H-3D, L-11C

RWY 08-26: H8704X150 (ASPH-PFC) S-75, D-200, 2S-175, 2D-250 IAP, AD

PCR 1020 F/B/X/T HIRL

RWY 08: REIL. VASI(V4L)—GA 3.0° TCH 49'.

RWY 26: MALSR. PAPI(P4L)—GA 3.0° TCH 55'.

RWY 12-30: H3224X75 (ASPH) S-19 PCR 157 F/B/X/T 1.3% up SE

RWY 12: Trees.

LAND AND HOLD—SHORT OPERATIONS

LDG RWY	HOLD—SHORT POINT	AVBL LDG DIST
RWY 08	12-30	4500
RWY 12	08-26	2750
RWY 26	12-30	3600

SERVICE: S4 FUEL 100LL, JET A1+ OX 1, 3 LGT When twr clsd

ACTIVATE MALSR Rwy 26, REIL Rwy 08, HIRL Rwy 08-26—CTAF.

PAPI Rwy 26 opr consly.

AIRPORT REMARKS: Attended 1330-0300Z†. Parachute Jumping. 100LL: Svc fee btn 0300-1330Z†; info 208-733-5920 or 539-4034. Line of sight btn Rwy 26 apch end NA. PPR unskd ACR ops gtr than 30 pax seats—amgr. Rwy 12-30 non ACR mov area. Twy G, H, J and K non ACR mov area. Ldg fee for FAR Part 121, 135 opr & GA Part 91 gtr than 12,500 lb maximum gross landing weight.

AIRPORT MANAGER: 208-733-5215

WEATHER DATA SOURCES: ASOS 135.025 (208) 733-1878. SAWRS/WSO/AG.


COMMUNICATIONS: CTAF 118.2 UNICOM 122.95

TWIN FALLS APP/DEP CON 126.7 (1300-0400Z†)

® SALT LAKE CENTER APP/DEP CON 118.05 (0400-1300Z†)

TWIN FALLS TOWER 118.2 (1300-0400Z†) GND CON 121.7 CLNC DEL 123.65

CLEARANCE DELIVERY PHONE: For CD when ATCT clsd ctc Salt Lake ARTCC at 801-320-2568.

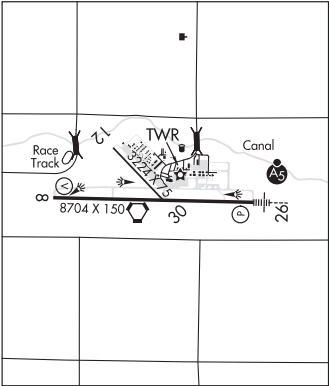

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS D svc 1300-0400Z†; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE TWF.

TWIN FALLS (VL) (H) VORTACW 113.1 TWF Chan 78 N42°28.79' W114°29.37' at fld. 4149/18E.

VOR unusable:

000°-010° byd 40 NM blo 7,000'
 000°-010° byd 50 NM
 011°-015° byd 40 NM
 040°-091° byd 40 NM
 092°-102° byd 40 NM blo 16,500'
 092°-102° byd 77 NM
 103°-106° byd 40 NM
 107°-117° byd 40 NM blo 14,000'
 107°-117° byd 64 NM blo 22,000'
 118°-171° byd 40 NM
 120°-160° byd 35 NM blo 12,000'
 172°-182° byd 40 NM blo 13,000'
 172°-182° byd 55 NM
 183°-185° byd 40 NM
 186°-196° byd 40 NM blo 10,600'
 186°-196° byd 57 NM
 197°-230° byd 40 NM

TACAN AZIMUTH unusable:

120°-160° byd 35 NM blo 12,000'

DME unusable:

120°-160° byd 35 NM blo 12,000'

STRIK NDB (LOM) 389 TW N42°28.72' W114°21.26' 259° 5.9 NM to fld.

ILS 108.3 I-TWF Rwy 26. Class IE. LOM STRIK NDB. Unmonitored when ATCT clsd.

COMM/NAV/WEATHER REMARKS: Frequency 121.5 not avbl at twr.

UPPER LOON CREEK USFS (See CHALLIS on page 45)

W E RANCH (See THATCHER on page 86)

WAPSHILLA (See WINCHESTER on page 88)

WARM SPRINGS CREEK (See LOWMAN on page 63)

WARREN (USFS) (3U1) 0 NW UTC-7(-6DT) N45°16.09' W115°41.02'

GREAT FALLS

5902 NOTAM FILE BOI

RWY 12-30: 2765X50 (DIRT) 1.2% up SE

RWY 12: Trees.

RWY 30: Road.

AIRPORT REMARKS: Unattended. No winter maint. Rwy width varies from 65' to 85'. Rcnd Ind Rwy 12 and tkof Rwy 30 when wind conds allow. Downdrafts prevalent Rwy 12 summer months. Recommended use early morning and late evening in summer. Not recommended for inexperienced pilots. Do not use adjacent pvt road southwest of rwy for tkf or ldg. Road crosses rwy aprx 800' from Rwy 12 thld. No telephone avbl at arpt. Rwy 12 thr mkd with non-std w rock bdry mkr.

Rwy 30 thld poorly defined. Rwy 12-30 has some loose rocks to 2" in diameter, isolated spots of embedded flat rocks to 6" in diameter and some spotty weed growth to 12". Rwy 12 +4 ft dredge tailings 0 ft, 65 ft R; +4 ft dredge tailings 350 ft on cntrln; +70 ft trees at 600 ft on cntrln; +200 ft rdg at 1000 ft on cntrln. Rwy 30 +25 ft bldg at 70 ft, 85 ft L; +10 ft bldg at 130 ft, 70 ft L; +10 ft pvt road at 130 ft, 35 ft L; +5 ft log fence at 100 ft, 25 ft L.

AIRPORT MANAGER: (208) 634-0975

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.

WEATHERBY USFS (See ATLANTA on page 34)