

**WACO RGNL** (ACT)(KACT) 5 NW UTC-6(-5DT) N31°36.73' W97°13.82'

516 B ARFF Index—See Remarks NOTAM FILE ACT

**RWY 01-19:** H7107X150 (ASPH-GRVD) S-50, D-82, 2S-121,  
2T-276, 2D-166, 2D/2D2-166, C5-466 PCR 547 F/B/W/T HIRL  
**RWY 01:** PAPI(P4R)—GA 3.0° TCH 55'. RVR-R Thld dsplcd 102'.  
Road.

**RWY 19:** MALSR. RVR-T

**RWY 14-32:** H5103X150 (ASPH-GRVD) S-50, D-82, 2S-104  
PCR 462 F/B/W/T MIRL

**RWY 14:** REIL. PAPI(P4L)—GA 3.0° TCH 58'.

**RWY 32:** PAPI(P4L)—GA 3.0° TCH 58'. Road.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 01:** TORA-7107 TODA-7107 ASDA-7107 LDA-7005

**RWY 14:** TORA-5103 TODA-5103 ASDA-5103 LDA-5103

**RWY 19:** TORA-7107 TODA-7107 ASDA-6605 LDA-6605

**RWY 32:** TORA-5103 TODA-5103 ASDA-5103 LDA-5103

**SERVICE:** S4 FUEL 100LL, JET A, UL94 OX1 LGT When ATCT clsd:  
MALSR Rwy 19; HIRL Rwy 01-19 preset low intst, to incr intst  
ACTVT—CTAF. REIL Rwy 14; MIRL Rwy 14-32; twy lgts preset low  
intst when wind favors, otrw not avbl.

**AIRPORT REMARKS:** Attended 1200-0400Z†. Class I, ARFF Index B. PPR  
for unscheduled air carrier ops call arpt manager 254-750-8657.

NOTE: See Special Notices—Model Aircraft Activity.

**AIRPORT MANAGER:** 254-750-8657

**WEATHER DATA SOURCES:** ASOS (254) 218-3267

**COMMUNICATIONS:** CTAF 119.3 ATIS 123.85 UNICOM 122.95

RCO 122.6 (FORT WORTH RADIO)

- Ⓡ APP CON 127.65 (1200-0600Z†)
- Ⓡ DEP CON 126.125 (1200-0600Z†)
- Ⓡ FORT WORTH CENTER APP/DEP CON 133.3 (0600-1200Z†)

TOWER 119.3 (1200-0600Z†) GND CON 121.9

**CLEARANCE DELIVERY PHONE:** For CD ctc waco Apmh at 121.9 or ctc Fort Worth ARTCC at 817-858-7584.

**AIRSPACE:** CLASS D svc 1200-0600Z†; other times CLASS E.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE ACT.


(VH) (H) VORTACW 115.3 ACT Chan 100 N31°39.73' W97°16.14' 137° 3.6 NM to fld. 507/9E.

VOR unusable:

- 125°-149° byd 40 NM
- 149°-159° byd 47 NM
- 159°-187° byd 40 NM
- 188°-198° byd 40 NM blo 12,000'
- 199°-234° byd 40 NM
- 235°-245° byd 50 NM
- 246°-256° byd 40 NM blo 18,000'
- 246°-256° byd 52 NM
- 257°-267° byd 58 NM
- 268°-282° byd 51 NM
- 270°-335° byd 35 NM blo 4,000'
- 283°-293° byd 40 NM blo 6,000'
- 283°-293° byd 58 NM
- 294°-330° byd 40 NM

ILS/DME 109.7 I-ACT Chan 34 Rwy 19. Class IE. ILS/DME unmonitored when ATCT closed.

ASR (1200-0600Z†)

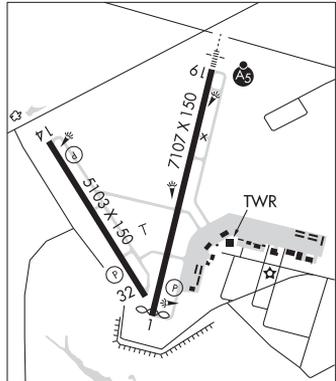

**WINGS FOR CHRIST INTL FLT ACADEMY** (73F) 8 NE UTC-6(-5DT) N31°37.43' W97°01.35'

SAN ANTONIO

455 NOTAM FILE FTW

**RWY 16-34:** 3000X80 (TURF) RWY LGTS(NSTD)

**RWY 16:** Thld dsplcd 315'. Fence.

**RWY 34:** Trees. Rgt tfc.

**SERVICE:** S2 LGT ACTVT LIRL Rwy 16-34—CTAF.

**AIRPORT REMARKS:** Attended continuously. 4' fence along both sides of rwy 70' from cntrln south half of rwy. Rwy 34 40' trees 90' fm thr.

**AIRPORT MANAGER:** 254-723-3277

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Fort Worth ARTCC at 817-858-7584.

**COMM/NAV/WEATHER REMARKS:** Arpt inside Class D airspace. Ctc TSTC twr 124.0.