

NEWBERRY CO (EOE)(KEOE) 3 N UTC-5(-4DT) N34°18.56' W81°38.44'

CHARLOTTE

570 B NOTAM FILE AND

L-24J


RWY 04-22: H4001X75 (ASPH-AFSC) S-23, D-30 MIRL

IAP

0.9% up NE

RWY 04: PAPI(P2L)—GA 3.15° TCH 42'. Trees.**RWY 22:** PAPI(P2L)—GA 3.15° TCH 43'. Pole. Rgt tfc.**SERVICE:** S4 FUEL 100LL LGT ACTVT PAPI Rwy 22; MIRL Rwy 04-22—CTAF. PAPI Rwy 04 oper consly.**AIRPORT REMARKS:** Unattended. Fuel self-serve. Deer on invof arpt.**AIRPORT MANAGER:** 803-944-0613**WEATHER DATA SOURCES:** AWOS-3 124.275 (803) 276-2419.**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ COLUMBIA APP/DEP CON 133.4

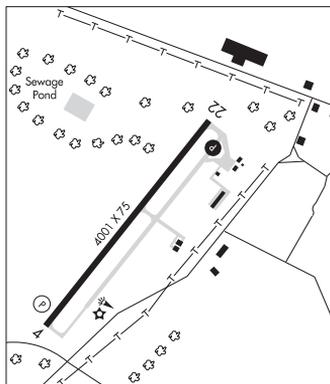CLEARANCE DELIVERY PHONE: For CD ctc Columbia Apch at 803-822-4511.**NORTH AF AUX** (XNO)(KXNO) AF UTC-5(-4DT) N33°36.57' W81°04.87'

CHARLOTTE

321 B TPA—See Remarks NOTAM FILE CHS Not insp.

H-9B, 12G, L-24J

RWY 06-24: H10003X150 (ASPH) PCN 48 R/B/W/T HIRL

DIAP, AD

RWY 06: Thld dsplcd 1000'.**RWY 24:** Thld dsplcd 1004'.**RWY 051-231:** H3500X90 (CONC) PCN 56 R/B/W/T**RUNWAY DECLARED DISTANCE INFORMATION****RWY 06:** TORA-8999 TODA-8999 ASDA-10003 LDA-9003**RWY 24:** TORA-9003 TODA-9003 ASDA-10003 LDA-8999**SERVICE:** MILITARY—LGT ACTVT HIRL Rwy 06-24-120.475. Rotg bcn off dur lgt out trng.**NOISE:** NS ABTMT: Ovf of North, SC proh.**MILITARY REMARKS:** Opr 1430-0900Z‡ Mon-Thu; Opr 1430-2100Z‡ Fri. Clsd Sat-Sun and Fed hol. See FLIP AP/1

Supplementary Arpt Remark. Rwy Cond Code (RwyCC) not rptd. **RSTD** Twy Delta clsd dur box-in-one ops to ALZ Rwy 23. Opr rstd dur Bird Watch Cond MODERATE (tkf or ldg permission only when departing/arr rte avoid identified bird act, no lcl IFR/VFR tfc pat act) and SEVERE (tkf and ldg prohibited without OG/CC apvl), ctc LZ/DZ ops facility for current Bird Watch Cond. Minimum 2 wk prior coord rqr for all users. Point of ctc is Charleston AFB, 437 OSS/OSO, DSN 673-5554, C843-963-5554. All aircrews will ctc North DZ on 120.475/235.775 prior to 5 NM North AF AUX. This airspace is subj to be rstd by NOTAM. Rwy 06-24, no 180° star turns on asph, conduct all turns on conc ends. All aircrews will ctc LZ/DZ on 120.475/235.775 prior to 5 nm from North AF Aux. LZ/DZ ops facility opr Mon-Thu 1430-0900Z‡, Fri 1430-2100Z‡, clsd Sat-Sun and federal hol. **CAUTION** Mil NVD may be conducted invof afld anytime btn SS and SR. Ints heavy mil jet and miscellaneous acft executing numerous cargo and personnel drops, hi-speed lo-level formation flt, and air/land opr. Rwy 06-24 NW tree line 750' from rwy cntrln. Rwy 06-24 large ditch 350' from rwy cntrln at midfld on NW side rwy. Ints gnd trng on reservation. Rwy 05-23 used as assault ldg zone (ALZ) 3500' x 90'. ALZ Rwy 05-23 no distance marker panels. Aerodrome ARFF at reduced level of svc, USAF CAT 4 due to veh shortage, 6800 gal avbl.

TFC PAT TPA—Rectangular 979' AGL/1300' MSL, Overhead 1479' AGL/1800' MSL. **MISC** ALZ Rwy 05-23 and Rwy 06-24 grooved. LZ/DZ ops facility ltd to advisory svc only, no ATC svcs provided, aircrews will ctc Columbia APP to req/activate IFR clnc. Cnl IFR clnc with Columbia APP prior to opr at North AF AUX. AN/FM/Q-19 automated obsvng sys in use, not augmented by human obsn. PMSV rdo unavbl. PMSV/phone patch avbl thru 628 CP DSN 673-8400 C843-963-8400. Mil wx advsly/wng/fcst updates avbl O/R via 437OSSS/OSW DSN 673-3016 C843-963-3016 dur opr hrs 1100-0100Z‡ Mon-Thu and 1100-2200Z‡ Fri, clsd wkend, hol, and down days. Msn wx spt for aircrew avbl via the 26 OWS/Barksdale AFB, DSN 331-2651 or C318-529-2651 dur mil wx flt closure hr.

AIRPORT MANAGER: 843-963-3028**COMMUNICATIONS:** LZ/DZ OPS 120.475 235.775 (Mon-Thu 1430-0900Z‡, Fri 1430-2100Z‡, clsd Sat-Sun and fed hol)**CLEARANCE DELIVERY PHONE:** For CD ctc Columbia Apch at 803-822-5242 or 803-822-5040.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE CAE.

COLUMBIA (VH) (H) VORTAC 114.7 CAE Chan 94 N33°51.44' W81°03.23' 187° 14.9 NM to fld. 404/2W.

VOR unusable:

- 000°-073° byd 35 NM blo 6,000'
- 200°-234° byd 12 NM blo 3,000'
- 235°-245° byd 12 NM blo 6,000'
- 246°-289° byd 12 NM blo 3,000'
- 290°-305° byd 12 NM blo 2,400'
- 306°-344° byd 30 NM
- 345°-359° byd 10 NM blo 5,000'

COMM/NAV/WEATHER REMARKS: ASOS 118.525 located at Orangeburg Muni (K0GB)

NORTH MYRTLE BEACH

GRAND STRAND (CRE)(KCRE) 1 NW UTC-5(-4DT) N33°48.71' W78°43.44'

32 B NOTAM FILE CRE MON Airport

RWY 05-23: H5997X100 (ASPH) S-76, D-112 PCN 29 F/B/X/T HIRL

RWY 05: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Trees.

RWY 23: MALSR. PAPI(P2R)—GA 2.98° TCH 55'. Trees. Rgt tfc.

SERVICE: FUEL 100LL, JET A LGT After 0500Z‡ ACTIVATE HIRL Rwy 05-23, REIL Rwy 05, and MALSR Rwy 23—CTAF.

AIRPORT REMARKS: Attended 1200-0200Z‡. Gulls on and invof arpt. Extv banner tow ops from arpt along coastline 10 NM NE to 20 SW.

AIRPORT MANAGER: 843-448-1580

WEATHER DATA SOURCES: ASOS 119.625 (843) 361-2802.

COMMUNICATIONS: CTAF 124.6 ATIS 119.625 UNICOM 122.95

RCO 122.5 (ANDERSON RADIO)

Ⓡ MYRTLE BEACH APP/DEP CON 119.2 (1100-0400Z‡)

Ⓡ JACKSONVILLE CENTER APP/DEP CON 134.375 (0400-1100Z‡)

TOWER 124.6 (1200-0200Z‡) GND CON 121.8 CLNC DEL 121.8

CLEARANCE DELIVERY PHONE: For CD when ATCT clsd ctc Myrtle Beach Apch at 843-477-2727/2704. When MYR Apch clsd ctc Jacksonville ARTCC at 904-845-1592.

AIRSPACE: CLASS D svc 1200-0200Z‡; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE CRE.

(VL) (H) VORTACW 114.4 CRE Chan 91 N33°48.83' W78°43.47' at fld. 27/3W.

TACAN AZIMUTH unusable:
296°-335°

DME unusable:
296°-335°

VOR unusable:


- 000°-005° byd 40 NM
- 016°-020° byd 40 NM
- 040°-053° byd 40 NM blo 2,500'
- 040°-053° byd 47 NM
- 060°-085° byd 40 NM
- 130°-140° byd 40 NM
- 205°-222° byd 40 NM blo 7,000'
- 205°-222° byd 82 NM
- 292°-296° byd 40 NM
- 296°-308° byd 30NM blo 5,000'
- 330°-334° byd 40 NM

ILS/DME 111.7 I-CRE Chan 54 Rwy 23. Class IT.

CHARLOTTE

H-9C, 12G, L-35A

IAP, AD

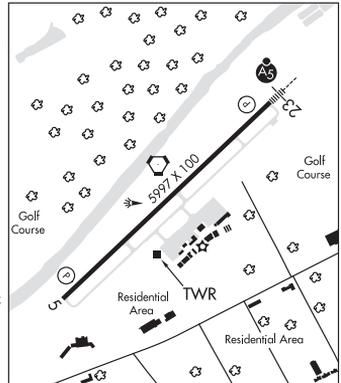

OCONEE CO RGNL (See CLEMSON on page 389)