
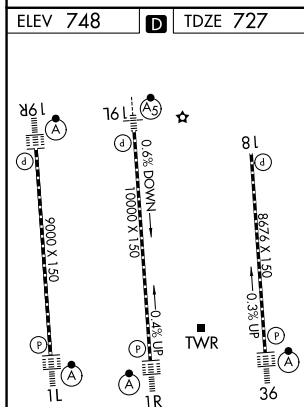


LOC/DME I-BQC 108.9 Chan 26	APP CRS 003°	Rwy Ldg 8390 TDZE 727 Apt Elev 748
---	------------------------	---

ILS RWY 36 (CAT II & III)
CHARLOTTE/DOUGLAS INTL (CLT)

DME or RADAR required.		ALSF-2	MISSED APPROACH: Climb to 1320 then climbing right turn to 4000 on heading 065° and GSO VORTAC R-226 to EDELL/GSO 54 DME/RADAR and hold, continue climb-in-hold to 4000.	
 Simultaneous approach authorized.				
D-ATIS	CHARLOTTE APP CON		CHARLOTTE TOWER	
	128.325 (001°-119°)	257.2 (180°-359°)	118.1 257.8 (18-36)	GND CON
121.15	120.05 (120°-295°)	307.8 (360°-179°)	126.4 257.8 (1R-19L)	121.8 348.6 (W)
	134.75 (296°-360°)		133.35 257.8 (1L-19R)	121.9 348.6 (E)

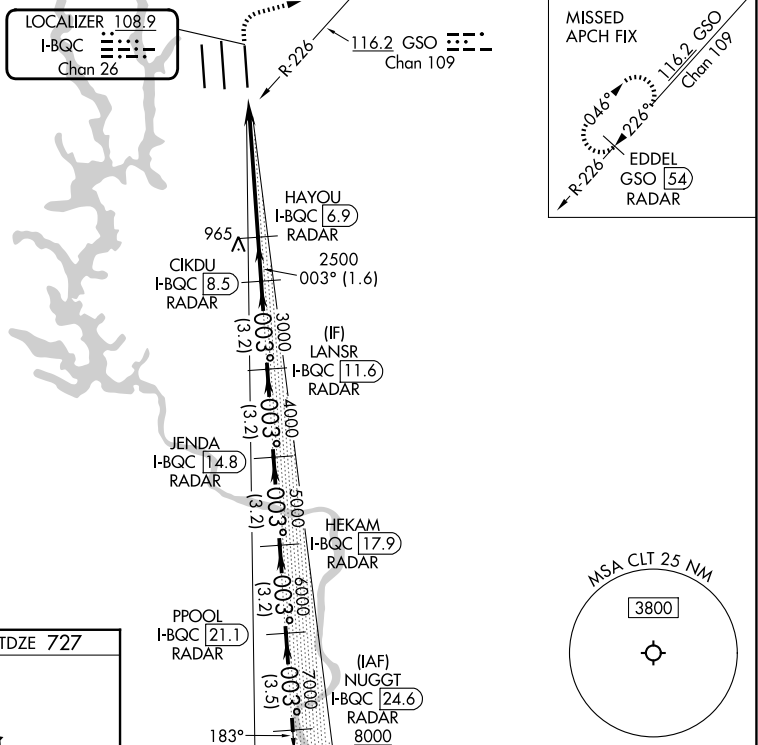

1320	4000	GSO R-226	EDDEL GSO [54]	LANSR I-BQC [11.6] RADAR	HEKAM I-BQC [17.9] RADAR	NUGGT I-BQC [24.6] RADAR
↑	hdg 065°					
1042° — 5.4 NM — 1.6 NM — 3.2 NM — 3.2 NM — 3.2 NM — 3.2 NM — 3.5 NM —						
CATEGORY	A B C D					
S-ILS 36	CAT II RA 119/12 100 DA 827					
S-ILS 36	CAT III RVR 06					

CATEGORY II & III ILS SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED